

## Update Barcode Scanner USB-COM Driver

**Step 1,** Let scanner connect with PC, and scan the configuration barcode ‘USB Virtual COM Port’.



Figure 1.0

**Step 2** Control Panel--> Device Manager-->Other Devices-->XB-2D PRODUCT USB UART, right click this option, and choose option Update Driver Software.

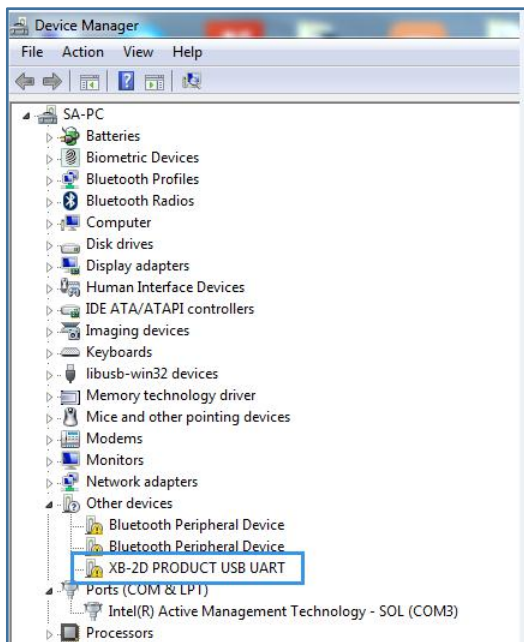


Figure 2.0

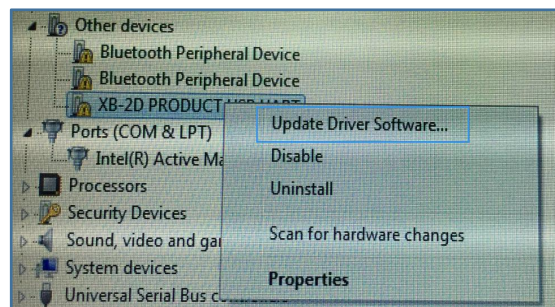


Figure 2.1

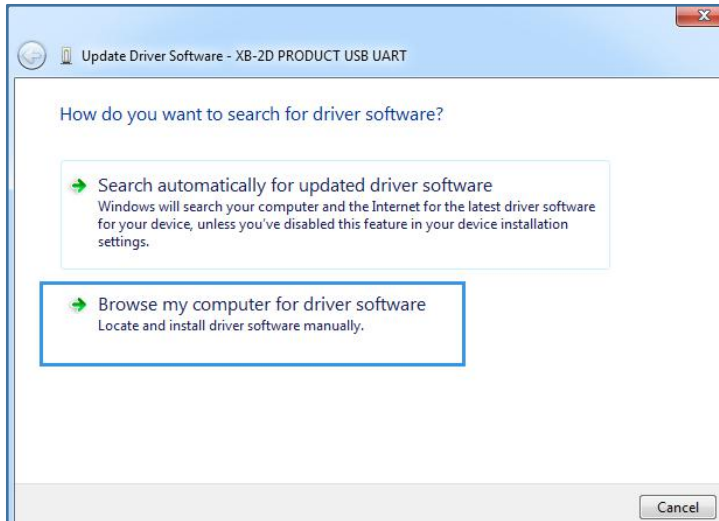


Figure 2.2

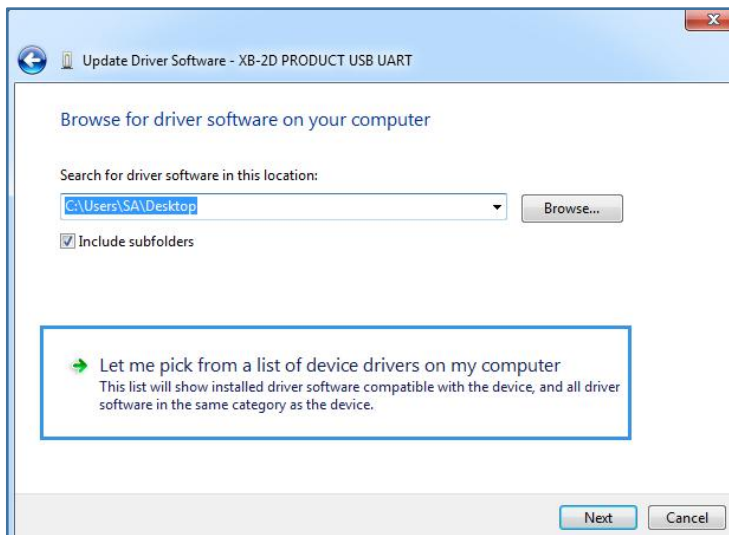


Figure 2.3

Choose option Ports(COM & LPT), then click icon Next, and click icon ‘Have Disk...’ in figure 2.5.

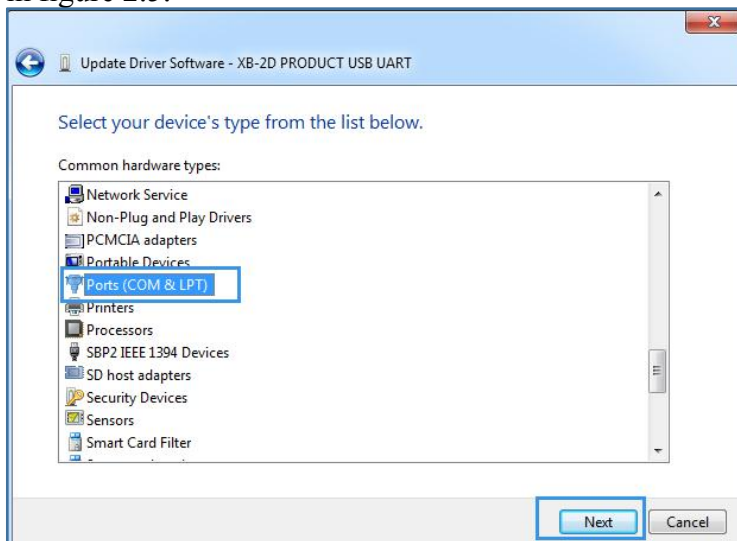


Figure 2.4

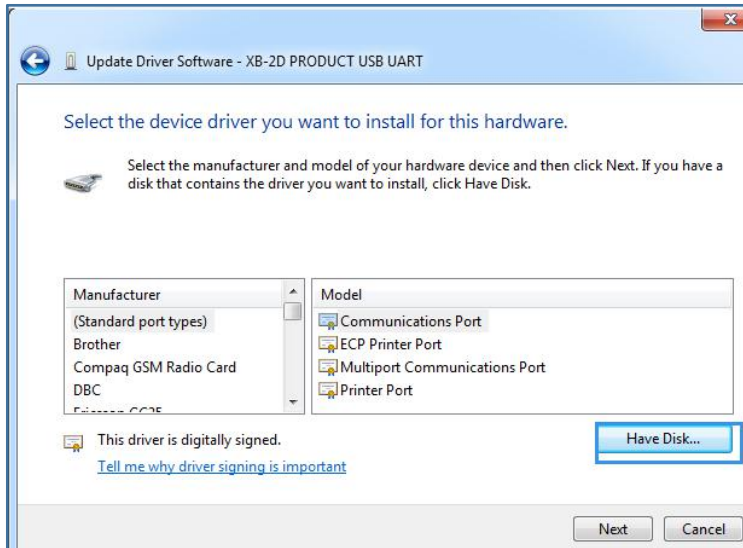


Figure 2.5

Click icon Browse to choose related update file 'XB\_UsbToUartDriver'. Then click icon Open and OK in figure 2.7 and 2.8.

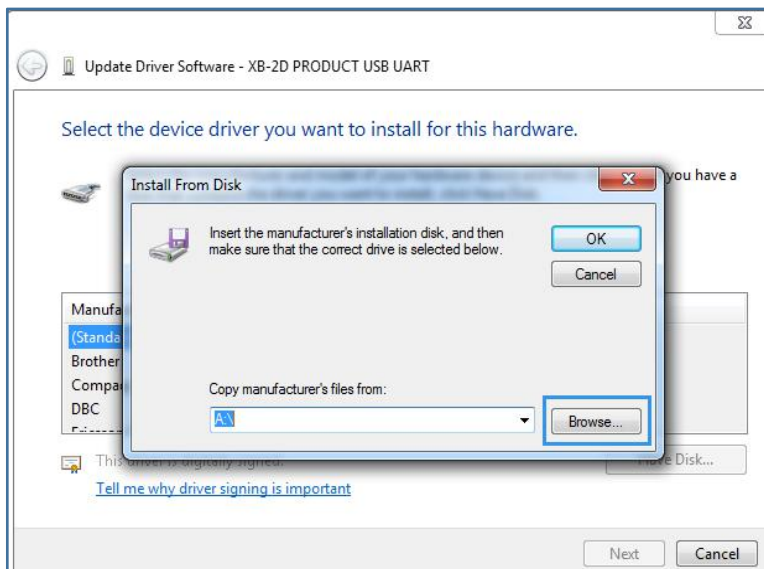


Figure 2.6

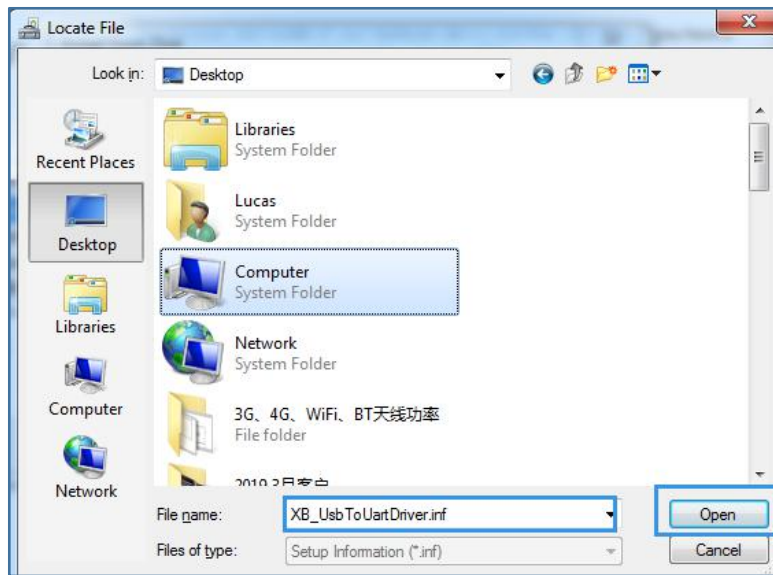


Figure 2.7

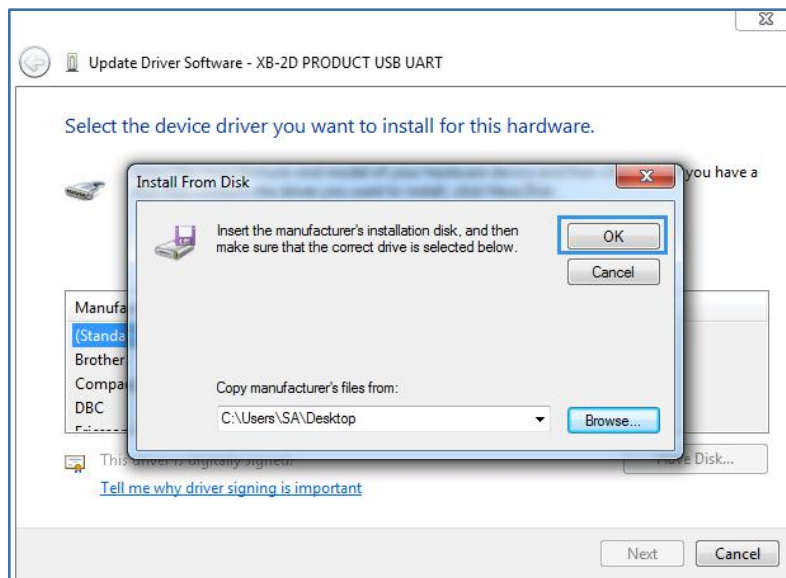


Figure 2.8

Ignore the prompt message ‘This driver is not digitally signed!’, click icon Next.

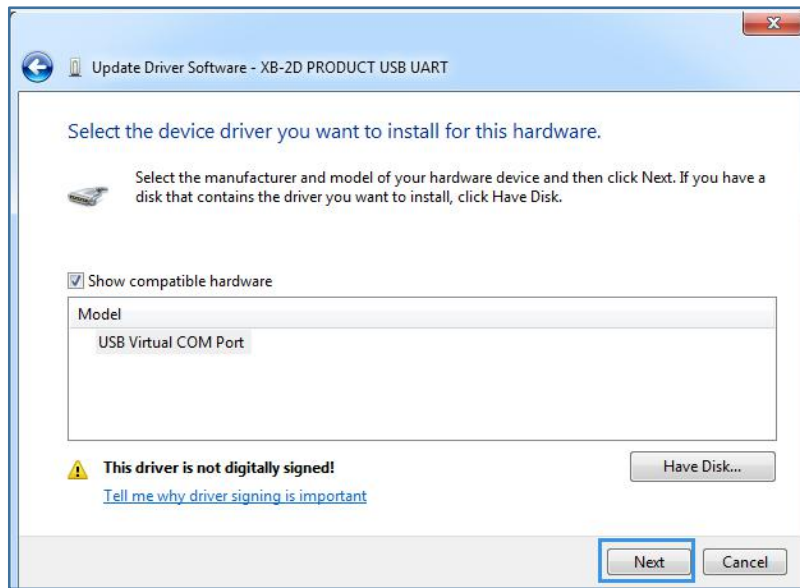


Figure 2.9



Figure 2.10

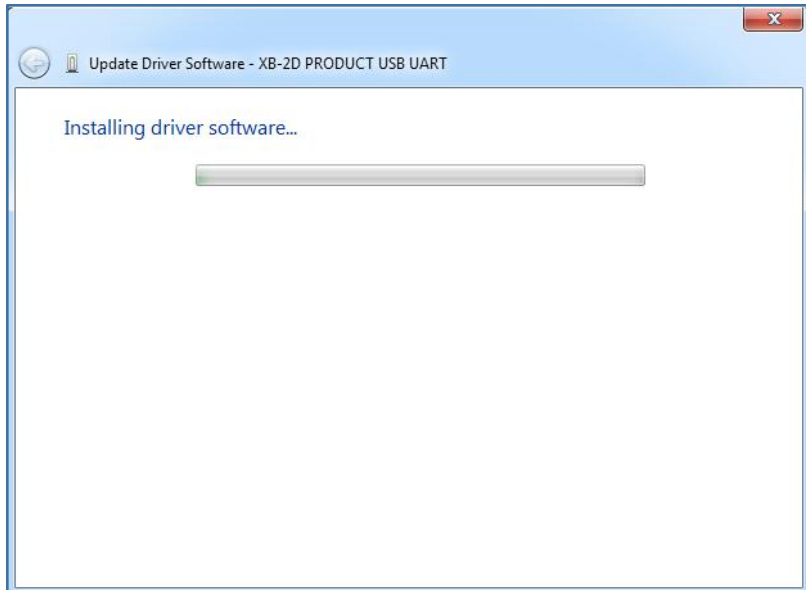


Figure 2.11

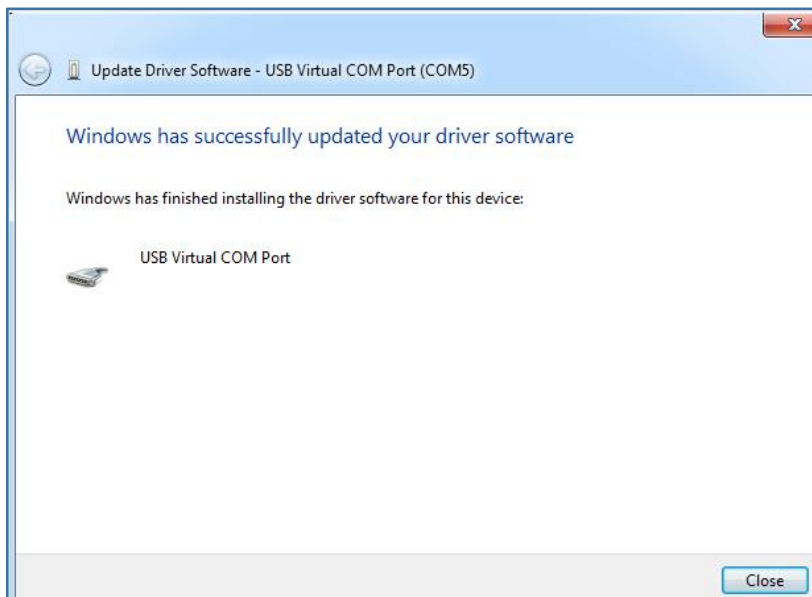


Figure 2.12



**Step 3,** Check the barcode scanner connected with which COM port, of course, you also could change relevant COM port, and make it connect to the port you expected.

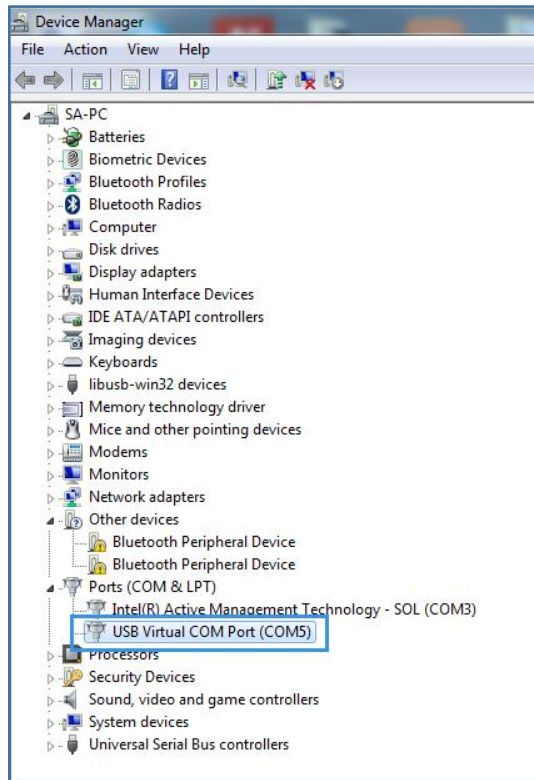


Figure 3.0

Right click 'USB Virtual COM Port...', and choose option 'Properties'.

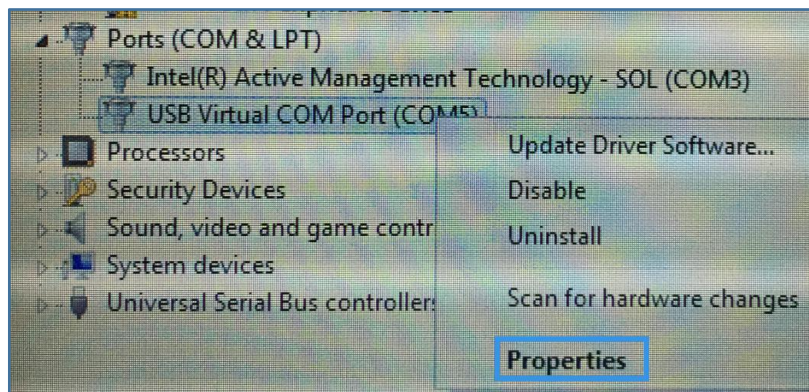


Figure 3.1

Click icon 'Port Settings' and 'Advanced...'

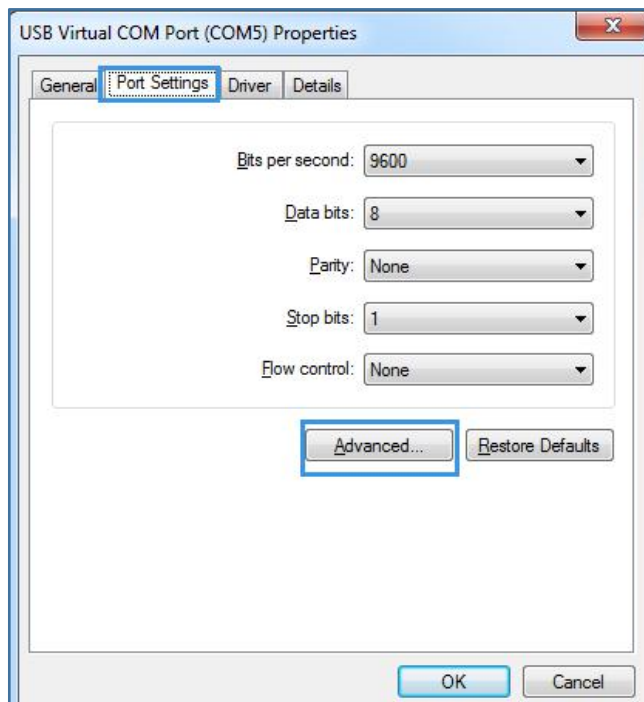


Figure 3.2

Choose proper COM port, and click OK to save configuration.

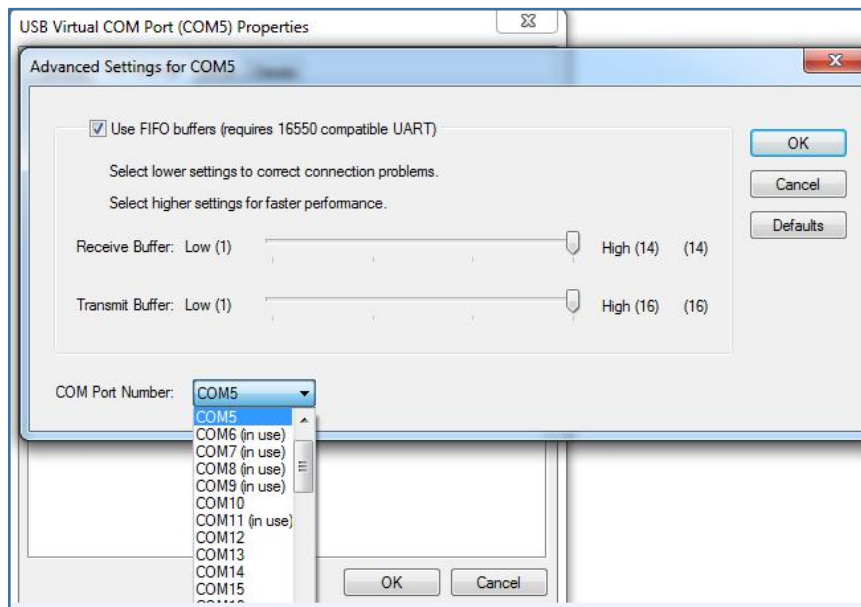


Figure 3.3

**The End**